



Critical
manufacturing
an ASM PT company

Line Verification

12.0.1

October 2026

DOCUMENT ACCESS

Public

DISCLAIMER

The contents of this document are under copyright of Critical Manufacturing S.A. it is released on condition that it shall not be copied in whole, in part or otherwise reproduced (whether by photographic, or any other method) and the contents therefore shall not be divulged to any person other than that of the addressee (save to other authorized offices of his organization having need to know such contents, for the purpose for which disclosure is made) without prior written consent of submitting company.

Line Verification

 Copy Page 

The Line Verification feature addresses the need for systematic verification activities while a **Material** is being processed. These verifications are particularly relevant in high-sensitivity production environments, where any changes in conditions, such as operator shifts, can impact product quality.

Info

- Maintenance Management is a separately licensed module required to access this feature.
- This feature is part one of a two-part process that pairs seamlessly with the Setup and Line Clearance feature. Check out the [Setup and Line Clearance](#) tutorial.

Overview

In this tutorial, we will explore expand the following sections:

- Feature Overview – explaining how Line Verification works
- Scenario – presenting a simplified example to understand the logic
- Configuration – showing a step-by-step guide to trigger verifications on in-process **Materials**, after shift breaks and shift changes
- Execution – triggering in-process **Material** verification using the feature
- Final Notes – pointing out some additional insights and considerations

Feature Overview

This feature is event-based and is triggered after a **Material** is tracked, ensuring that critical verification occurs while the **Material** is in-process.

The feature is implemented within the Maintenance Management module and is driven by a **Maintenance Plan** assigned dynamically through a context resolution of the Smart Table `MaterialInProcessVerificationContext`, creating a **Maintenance Plan** Instance when a **Material** is tracked in. This plan outlines the specific verification activities required for each **Material** during processing. In this tutorial, we will explore the time based activities, triggered on shift change events.

Once a **Material** is tracked in, a **Maintenance Plan** Instance is created and remains active throughout the time the **Material** is in-process, until it is tracked out. During this window, there is the need to execute verification activities, such as inspecting equipment, recalibrating scales, and checking environmental conditions (for example, temperature or humidity).

Scenario

To assess how this industry and production requirement is addressed by Critical Manufacturing MES, let's consider a simplified model:

- **Shift Definition:** 6 shifts covering 24 hours.
- **Facility:** General Facility
- **Area:** Area 1
- **Flow and Step:** General Flow with Step 1
- **Products:** Product A
- **Resources:** Resource 1
- **Service:** Service A, required by Step 1 and Provided by Resource 1
- **Role**

Suppose that the process at Step 1 requires the operator with the Process Verification Role to monitor the temperature and humidity of the environment whenever a **Material** is in-process, at two specific moments: when the next shift employees return from their mid-shift break, and after a shift change. There is a scheduled and automatically triggered verification requested for the material that was left in-process.

Additionally, during shift changes, the new operators are required to:

- Confirm that all necessary durables are in the correct position
- Acknowledge the materials that are currently in line for processing at Step 1.

Configuration

Basic entities like **Facility**, **Area**, **Services**, **Products**, **Parameters**, **Resources** and **Roles** won't be detailed.



Useful Documentation



There are some entities whose configurations require closer attention:

- **Calendar** and **Shift Definition**
- **Step**
- **Data Collection** and **Checklist**
- **Maintenance Plan**

Calendar and Shift Definition


This scenario assumes the existence of a **Calendar** with a **Shift Definition** that includes six shifts, covering the full 24-hour day.

Keep in mind the correct sequence when setting this up:

- First, create the Calendar.
- Then, define the Shift Definition.
- Finally, associate the Shift Definition with the Calendar.

The following images display the general configuration settings of the **Calendar** and **Shift Definition**:

Calendar

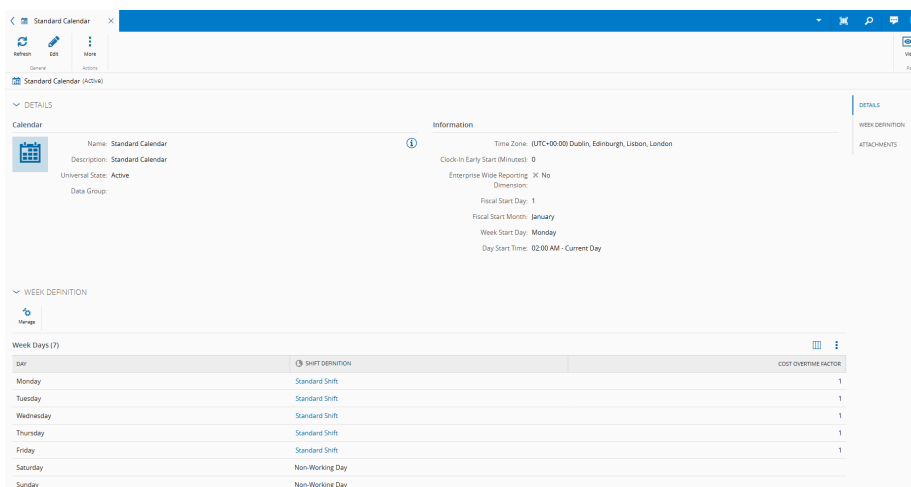

Day	Shift Definition	Cost Overtime Factor
Monday	Standard Shift	1
Tuesday	Standard Shift	1
Wednesday	Standard Shift	1
Thursday	Standard Shift	1
Friday	Standard Shift	1
Saturday	Non-Working Day	
Sunday	Non-Working Day	

Shift Definition

Standard Shift

Standard Shift (Active)

DETAILS

Shift Definition

Name: Standard Shift

Description: Standard Shift

Universal State: Active

Data Group:

Information

Calendar: Standard Calendar

Start Time: 02:00 AM

SHIFTS

Shifts (6)

NAME	START TIME	END TIME	COST OVERTIME FACTOR	TEAM PATTERN	CODE AND COLORS	
Shift 1	02:00	06:00	1			1 >
Shift 2	06:00	10:00	1			1 >
Shift 3	10:00	14:00	1			1 >
Shift 4	14:00	18:00	1			1 >
Shift 5	18:00	22:00	1			1 >
Shift 6	22:00	02:00	1			1 >

Rows per Page: 50

Page 1 of 1 (6 Records)


Useful Documentation

- [Create Calendar](#)
- [How to: Create a Calendar](#)
- [Create Shift Definition](#)
- [How to: Create a Shift Definition](#)

Step

For a **Step** to support in-process verification, the property `Enable In-Process Verification` must be set to true under the Settings section in the details of the **Step**.

The following images display the general configuration of the **Step**.

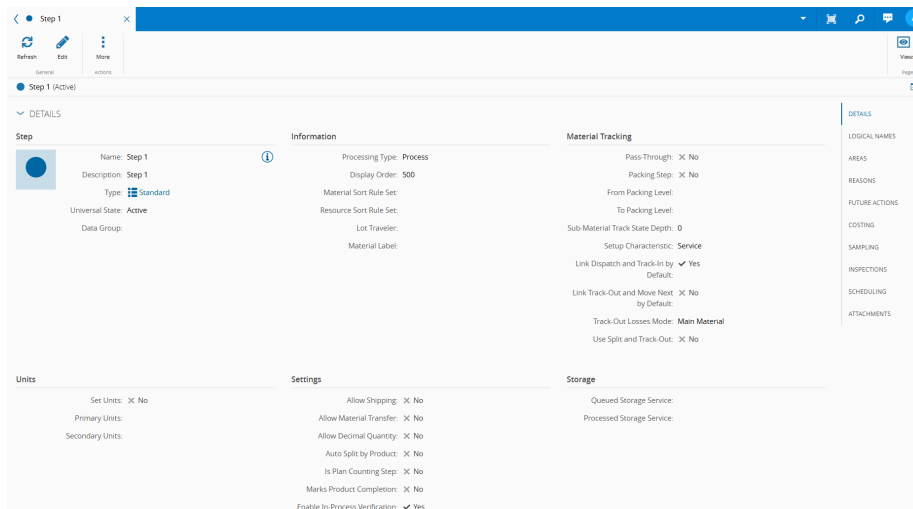

Step 1

Information

- Name: Step 1
- Description: Step 1
- Type: Standard
- Universal State: Active
- Data Group:
- Processing Type: Process
- Display Order: 500
- Material Sort Rule Set:
- Resource Sort Rule Set:
- Lot Traveler:
- Material Label:

Material Tracking

- Pass-Through: ☒ No
- Packing Step: ☒ No
- From Packing Level:
- To Packing Level:
- Sub-Material Track State Depth: 0
- Setup Characteristic: Service
- Link Dispatch and Track-In by: ☒ Yes
- Link Track-Out and Move Next: ☒ No
- Track-Out Losses Mode: Main Material
- Use Split and Track Out: ☒ No

Units

- Set Units: ☒ No
- Primary Units:
- Secondary Units:

Settings

- Allow Shipping: ☒ No
- Allow Material Transfer: ☒ No
- Allow Decimal Quantity: ☒ No
- Auto Split by Product: ☒ No
- Is Plan Counting Step: ☒ No
- Marks Product Completion: ☒ No
- Enable In-Process Verification: ☒ Yes

Storage

- Queued Storage Service:
- Processed Storage Service:


Useful Documentation

- [Create Step](#)
- [How to: Create a Step](#)

Data Collection and Checklist

The Data Collection consists of gathering a sample and recording two key **Parameters**: Temperature and Humidity.

The following image displays the general configuration of the **Data Collection**.

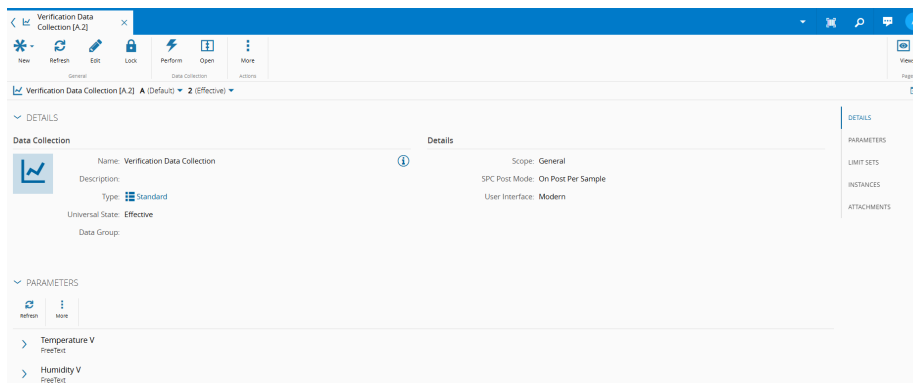

Verification Data Collection (A.2)

Details

- Name: Verification Data Collection
- Description:
- Type: Standard
- Universal State: Effective
- Data Group:
- Scope: General
- SPC Post Mode: On Post Per Sample
- User Interface: Modern

PARAMETERS

- Temperature V
- Humidity V


The **Checklist** is scoped under Maintenance Management and incorporates the **Data Collection**. Since the requirements differ for each scenario, there are two distinct

Checklists.

The Shift Break **Checklist** includes two items, each corresponding to the collection of one **Parameter**: temperature and humidity.

The following images display the configuration of the Shift Break **Checklist**.

Shift Break

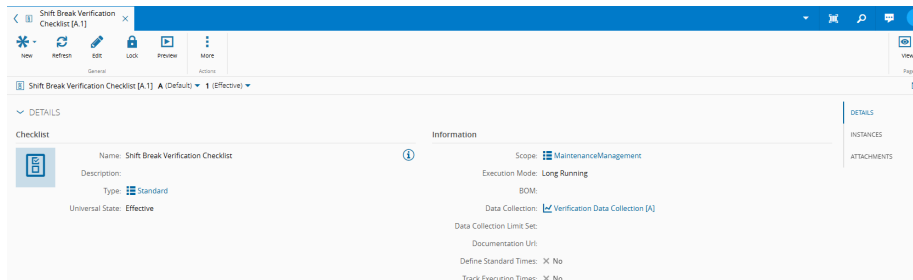

Shift Break Verification Checklist [A.1]

Checklist

Name: Shift Break Verification Checklist

Description:

Type: Standard

Universal State: Effective

Information

Scope: MaintenanceManagement

Execution Mode: Long Running

BOM:

Data Collection: Verification Data Collection [A]


Data Collection Limit Set:

Documentation Url:

Define Standard Times: X No

Track Execution Times: X No

Item 1 - General Data

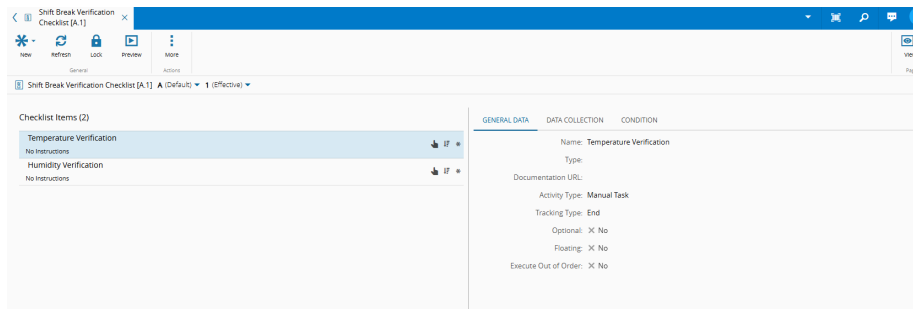

Shift Break Verification Checklist [A.1]

Checklist Items (2)

Temperature Verification

No Instructions

Humidity Verification

No Instructions

GENERAL DATA

Name: Temperature Verification

Type:

Documentation URL:

Activity Type: Manual Task


Tracking Type: End

Optional: X No

Floating: X No

Execute Out of Order: X No

Item 1 - Data Collection

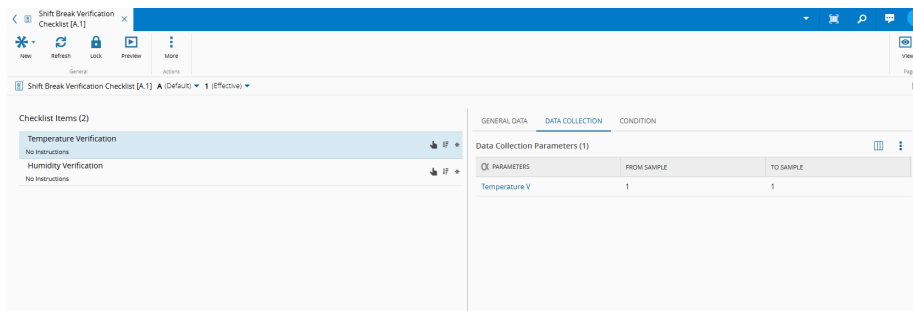

Shift Break Verification Checklist [A.1]

Checklist Items (2)

Temperature Verification

No Instructions

Humidity Verification


No Instructions

DATA COLLECTION

Data Collection Parameters (1)

PARAMETERS	FROM SAMPLE	TO SAMPLE
Temperature V	1	1

Item 2 - General Data

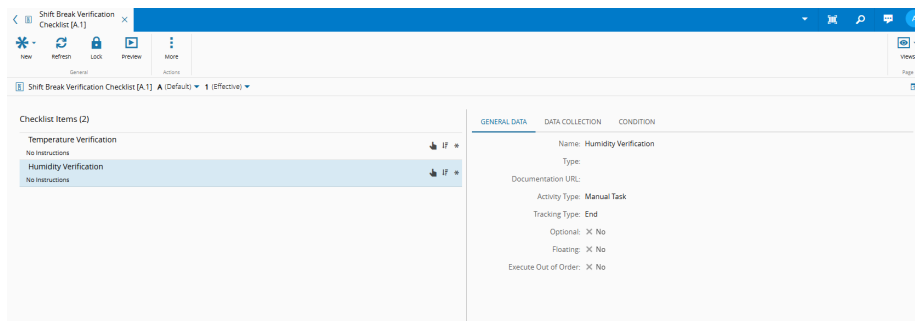

Shift Break Verification Checklist [A.1] A (Default) 1 (Effective)


Checklist Items (2)

- Temperature Verification
No Instructions
- Humidity Verification
No Instructions

GENERAL DATA DATA COLLECTION CONDITION

Name: Humidity Verification
Type:
Documentation URL:
Activity Type: Manual Task
Tracking Type: End
Optional: X No
Floating: X No
Execute Out of Order: X No

Item 2 - Data Collection

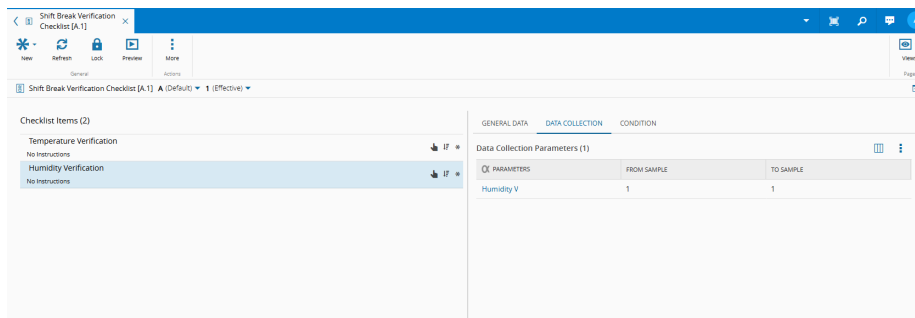

Shift Break Verification Checklist [A.1] A (Default) 1 (Effective)

Checklist Items (2)

- Temperature Verification
No Instructions
- Humidity Verification
No Instructions

GENERAL DATA DATA COLLECTION CONDITION

Data Collection Parameters (1)

PARAMETERS	FROM SAMPLE	TO SAMPLE
Humidity V	1	1

The Shift Change **Checklist** contains four items:

- The first two are the same as in the shift break case, capturing Temperature and Humidity data.
- The remaining two require the operator to verify:
 - That Durables are in the correct position.
 - The status and acknowledgment of Work In Progress materials queued at the step.

The following images display the configuration of the Shift Change **Checklist**.

Shift Change



Shift Change Verification Checklist [A.1] A (Default) 1 (Effective)

DETAILS

Checklist

Name: Shift Change Verification Checklist

Description:

Type: Standard

Universal State: Effective

Information

Scope: MaintenanceManagement

Execution Mode: Long Running

BOM:

Data Collection: Verification Data Collection [A]

Data Collection Limit Set:

Documentation Unit:

Define Standard Times: X No

Track Execution Times: X No

DETAILS

INSTANCES

ATTACHMENTS

Item 1 - General Data

Shift Change Verification Checklist [A.1] A (Default) 1 (Effective)

Checklist Items (4)

Temperature Verification

No Instructions

Humidity Verification

No Instructions

Check durables position

No Instructions

Check incoming WIP

No Instructions

GENERAL DATA

DATA COLLECTION

CONDITION

Name: Temperature Verification

Type:

Documentation URL:

Activity Type: Manual Task

Tracking Type: End

Optional: X No

Floating: X No

Execute Out of Order: X No

Item 1 - Data Collection

Shift Change Verification Checklist [A.1] A (Default) 1 (Effective)

Checklist Items (4)

Temperature Verification

No Instructions

Humidity Verification

No Instructions

Check durables position

No Instructions

Check incoming WIP

No Instructions

GENERAL DATA

DATA COLLECTION

CONDITION

Data Collection Parameters (1)

PARAMETERS	FROM SAMPLE	TO SAMPLE
Temperature V	1	1

Item 2 - General Data

Shift Change Verification Checklist...

New

Refresh

Lock

Preview

More

Views

Page

Shift Change Verification Checklist [A-1] A (Default) 1 (Effective)

Checklist Items (4)

Temperature Verification

No Instructions

👍

👎

✖

Humidity Verification

No Instructions

👍

👎

✖

Check durables position

No Instructions

👍

👎

✖

Check incoming WIP

No Instructions

👍

👎

✖

GENERAL DATA

DATA COLLECTION

CONDITION

Name: Humidity Verification

Type:

Documentation URL:

Activity Type: Manual Task

Tracking Type: End

Optional: ✖ No

Floating: ✖ No

Execute Out of Order: ✖ No

Item 2 - Data Collection

Shift Change Verification Checklist...

New

Refresh

Lock

Preview

More

Views

Page

Shift Change Verification Checklist [A-1] A (Default) 1 (Effective)

Checklist Items (4)

Temperature Verification

No Instructions

👍

👎

✖

Humidity Verification

No Instructions

👍

👎

✖

Check durables position

No Instructions

👍

👎

✖

Check incoming WIP

No Instructions

👍

👎

✖

GENERAL DATA

DATA COLLECTION

CONDITION

Data Collection Parameters (1)

PARAMETERS

FROM SAMPLE

TO SAMPLE

Humidity V

1

1

Item 3 - General Data

Shift Change Verification Checklist...

New

Refresh

Lock

Preview

More

Views

Page

Shift Change Verification Checklist [A-1] A (Default) 1 (Effective)

Checklist Items (4)

Temperature Verification

No Instructions

👍

👎

✖

Humidity Verification

No Instructions

👍

👎

✖

Check durables position

No Instructions

👍

👎

✖

Check incoming WIP

No Instructions

👍

👎

✖

GENERAL DATA

CONDITION

Name: Check durables position

Type:

Documentation URL:

Activity Type: Manual Task

Tracking Type: End


Optional: ✖ No

Floating: ✖ No

Execute Out of Order: ✖ No

Item 4 - General Data

Page 9 of 17

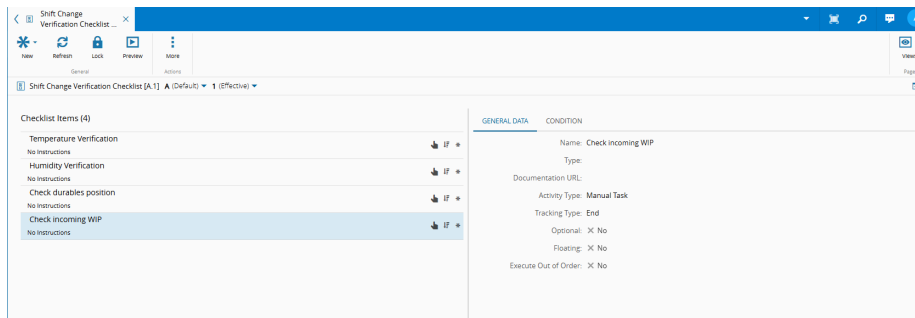


Useful Documentation

- [Create Data Collection](#)
- [How to: Create a Data Collection](#)
- [Create Checklist](#)
- [How to: Create a Checklist](#)

Maintenance Plan

For this scenario, we will define a single **Maintenance Plan** of scope In-Process Verification. The associated maintenance activities must use a time based schedule type, allowing us to leverage the "On Shift Change" time due scale to implement the intended logic.

The following image displays the configuration of the **Maintenance Plan**.

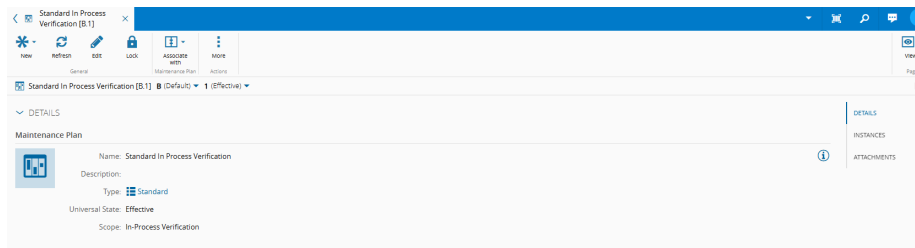


Maintenance Activities Overview:

Maintenance Activity Order	Trigger	Duration	Due Window	Tolerance	Activity
Shift Break Verification	Halfway through the shift (offset of 50%)	3 minutes (0.05 hours)	Must be completed 15 minutes (0.25 hours) after the mid-shift break	Cannot be performed before the halfway point of the shift, but can be completed anytime within the 15-minute window	Perform Shift Break Checklist and Data Collection
Shift Change Verification	When the shift changes	6 minutes (0.1 hours)	Must be completed 15 minutes (0.25 hours) after the shift change	Early or late completion allowed within a 15-minute window	Perform Shift Change Checklist and Data Collection

The following image displays the configuration of the Shift Break Verification maintenance activity.


General

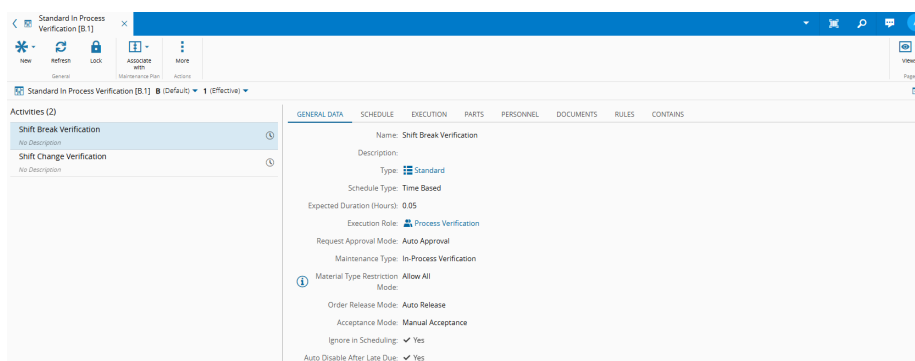

The screenshot shows the 'Standard In Process Verification (B.1)' configuration window. The left pane lists 'Shift Break Verification' and 'Shift Change Verification'. The right pane shows the configuration for 'Shift Break Verification' under the 'GENERAL DATA' tab. The configuration includes the following settings:

- Name: Shift Break Verification
- Description:
- Type: Standard
- Schedule Type: Time Based
- Expected Duration (Hours): 0.05
- Execution Role: Process Verification
- Request Approval Mode: Auto Approval
- Maintenance Type: In-Process Verification
- Material Type Restriction: Allow All
- Mode:
- Order Release Mode: Auto Release
- Acceptance Mode: Manual Acceptance
- Ignore in Scheduling: Yes
- Auto Disable After Late Due: Yes


Schedule

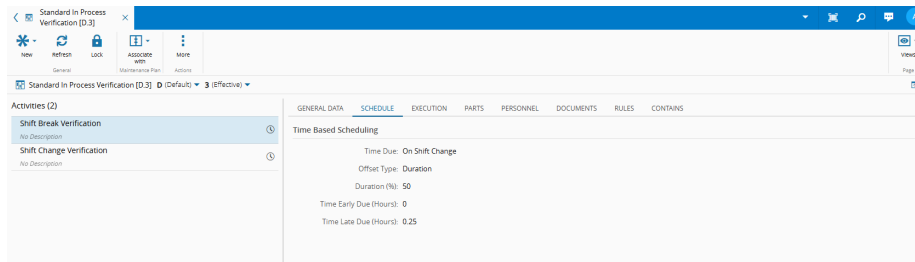

The screenshot shows the 'Schedule' tab for the 'Standard In Process Verification (D.3)' activity. The left sidebar lists two activities: 'Shift Break Verification' and 'Shift Change Verification'. The main panel displays 'Time Based Scheduling' with the following settings:

- Time Due: On Shift Change
- Offset Type: Duration
- Duration (H): 50
- Time Early Due (Hours): 0
- Time Late Due (Hours): 0.25

Execution

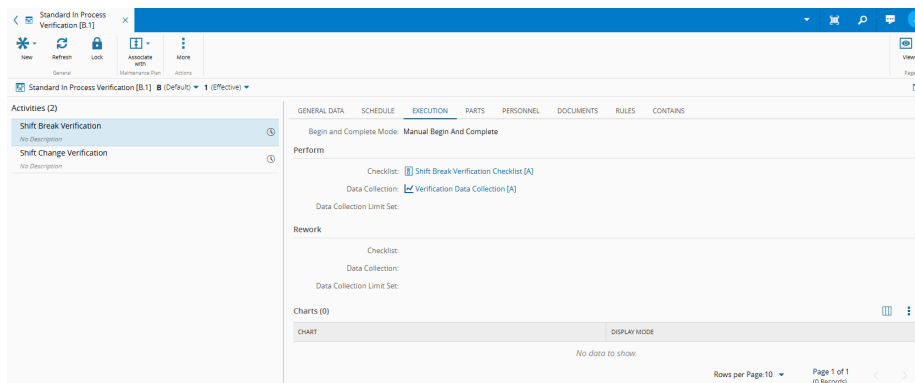


The screenshot shows the 'Execution' tab for the 'Standard In Process Verification (B.1)' activity. The left sidebar lists two activities: 'Shift Break Verification' and 'Shift Change Verification'. The main panel displays the 'Execution' settings:

- Begin and Complete Mode: Manual Begin And Complete
- Perform:
 - Checklist: Shift Break Verification Checklist [A]
 - Data Collection: Verification Data Collection [A]
 - Data Collection Limit Set:
- Rework:
 - Checklist:
 - Data Collection:
 - Data Collection Limit Set:
- Charts (0): No data to show.

At the bottom right, it indicates 'Page 1 of 1 (0 Records)'.

The following image displays the configuration of the Shift Change Verification maintenance activity.


General

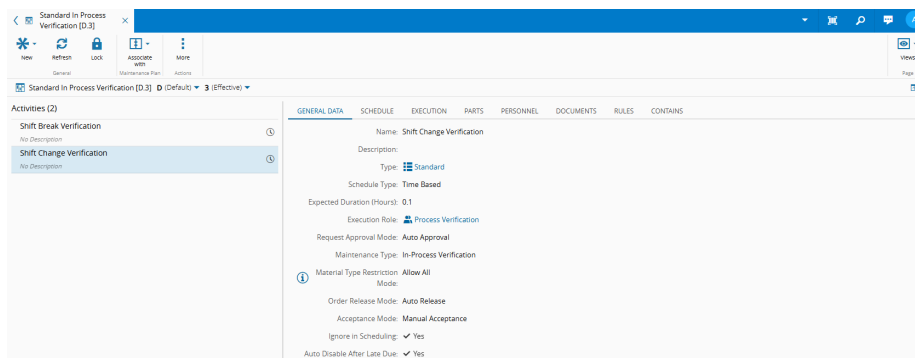


The screenshot shows the 'General' tab for the 'Standard In Process Verification (D.3)' activity. The left sidebar lists two activities: 'Shift Break Verification' and 'Shift Change Verification'. The main panel displays the 'General' settings:

- Name: Shift Change Verification
- Description:
- Type: Standard
- Schedule Type: Time Based
- Expected Duration (Hours): 0.1
- Execution Role: Process Verification
- Request Approval Mode: Auto Approval
- Maintenance Type: In-Process Verification
- Material Type Restriction: Allow All
- Mode:
- Order Release Mode: Auto Release
- Acceptance Mode: Manual Acceptance
- Ignore In Scheduling: Yes
- Auto Disable After Late Due: Yes

Schedule

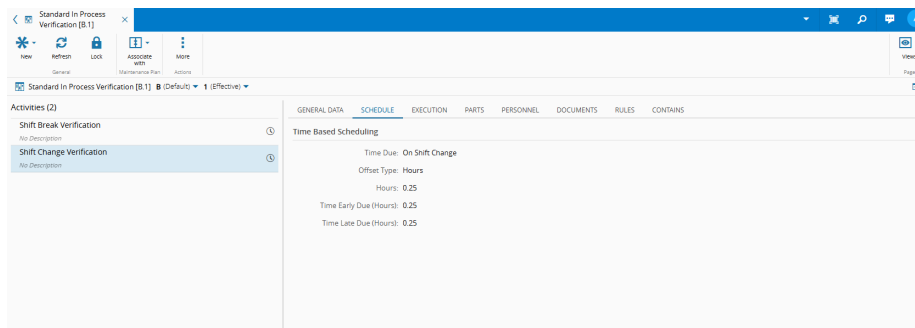

Execution

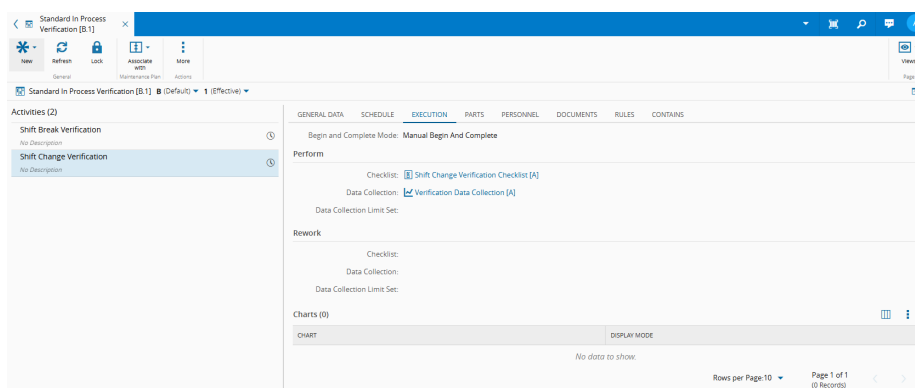

To connect all elements of the configuration, the system uses the Smart Table `MaterialInProcessVerificationContext`. In this table, it is defined:

- The **Step** (which must have In-Process Verification enabled)
- Optional context variables to refine applicability
- The corresponding **Maintenance Plan** to be triggered when the **Material** is tracked-in at that **Step**

The following table displays the Smart Table configuration.

Step	Maintenance Plan	Owner Role
Step 1	Standard In Process Verification	Process Verification

Useful Documentation

- How to: Assign Roles to a User
- How to: Add Value to Smart Table for assigning a **Maintenance Plan** to a **Step** on the MaterialInProcessVerificationContext Smart Table
- Create Maintenance Plan


This is the Master Data file used to create this model.

Execution


After all configurations are completed, the operation that sets everything in motion is the Track-In of a **Material** at a **Step** where in-process verification is enabled.

Once the **Material** is tracked in, navigating to the Material Maintenance View will display its Maintenance Plan Instances, as illustrated in the image below.

Shift Change

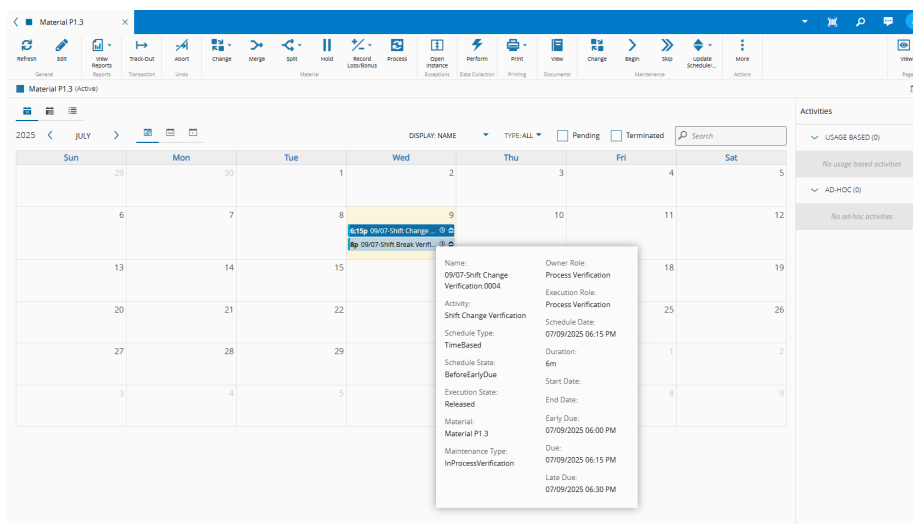

Shift Break

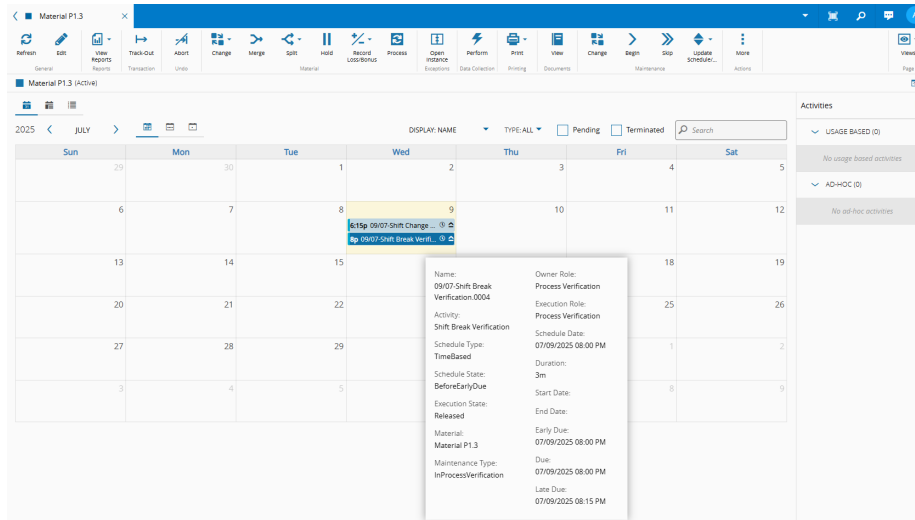

In the example, the **Material** was tracked in at 04:55 PM.


The next shift begins at 06:00 PM, so two Maintenance Activity Orders are created:

- One with a due date at 06:15 PM PM, for the Shift Change Verification
- Another with a due date at 08:00 PM, for the Shift Break Verification

If the due time arrives and the **Material** is still in process, the verification must be performed.

If a user attempts to Track-Out the **Material** without completing the required verification, the system will notify them about the pending In-Process Verification Maintenance Plan Instance.

Refer to the diagram below for a clear, visual timeline of these events.

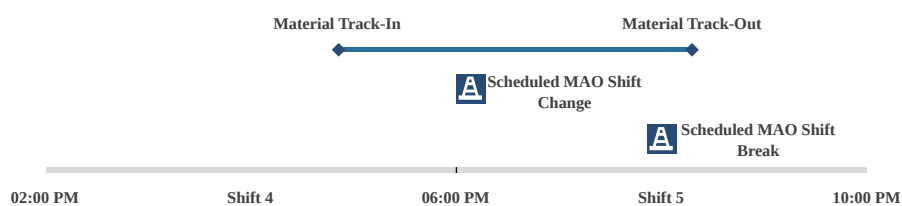

The operations required to carry out these verifications follow the standard Maintenance Activity Order flow: Begin, Perform, and Complete.

The video below illustrates the execution of this scenario.

<https://customer-40kvzg4z7gkyofrp.cloudflarestream.com/f9d81c3584a613533a382888aaa3f08a/iframe?poster=https%3A%2F%2Fcustomer-40kvzg4z7gkyofrp.cloudflarestream.com%2Ff9d81c3584a613533a382888aaa3f08a%2Fthumbnails%2Fthumbnail.jpg%3Ftime%3D%26height%3D600>

Useful Documentation

- For a more in-depth understanding of this module, please refer to the [[tutorials-maintenancemanagement]] tutorial.

Note

- The Material Traceability View includes a dedicated section to accommodate In-Process Verifications.
- The **Material** In-Process Verification Maintenance Plan Instance the reference to the associated instance.

Final Considerations

Keep in mind the following behaviors and consequences related to the In-Process Verification Maintenance Plan Instance:

- Terminate / Abort **Material** - Terminates the instance and clears the associated property
- Split / Expand **Material** - Resets the instance in the resulting child materials

- Merge **Material** - Merge is blocked if any of the Materials involved have an active instance
- Track-In **Material** - Creates a new Maintenance Plan Instance based on the resolved **Maintenance Plan** from the In-Process Verification context of the **Material**; sets the In Process Verification Maintenance Plan Instance accordingly
- Track-Out **Material** - Validates the Maintenance Activity Orders associated with the instance; if validation passes, terminates the instance and clears the property



Legal Information

Disclaimer

The information contained in this document represents the current view of Critical Manufacturing on the issues discussed as of the date of publication. Because Critical Manufacturing must respond to changing market conditions, it should not be interpreted to be a commitment on the part of Critical Manufacturing, and Critical Manufacturing cannot guarantee the accuracy of any information presented after the date of publication. This document is for informational purposes only.

Critical Manufacturing makes no warranties, express, implied or statutory, as to the information herein contained.

Confidentiality Notice

All materials and information included herein are being provided by Critical Manufacturing to its Customer solely for Customer internal use for its business purposes. Critical Manufacturing retains all rights, titles, interests in and copyrights to the materials and information herein. The materials and information contained herein constitute confidential information of Critical Manufacturing and the Customer must not disclose or transfer by any means any of these materials or information, whether total or partial, to any third party without the prior explicit consent by Critical Manufacturing.

Copyright Information

All title and copyrights in and to the Software (including but not limited to any source code, binaries, designs, specifications, models, documents, layouts, images, photographs, animations, video, audio, music, text incorporated into the Software), the accompanying printed materials, and any copies of the Software, and any trademarks or service marks of Critical Manufacturing are owned by Critical Manufacturing unless explicitly stated otherwise. All title and intellectual property rights in and to the content that may be accessed through use of the Software is the property of the respective content owner and is protected by applicable copyright or other intellectual property laws and treaties.

Trademark Information

Critical Manufacturing is a registered trademark of Critical Manufacturing.

All other trademarks are property of their respective owners.